

PRINTED: 04/09/2015
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL095002	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/11/2015
NAME OF PROVIDER OR SUPPLIER MOUNTAIN CARE FACILITIES		STREET ADDRESS, CITY, STATE, ZIP CODE 183 GRAGGVILLE ROAD BOONE, NC 28607		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 000	Initial Comments Report of Biennial Construction Survey by Dennis Harrell and Greg Cates on 3-11-2015. Information gathered from the DHSR Master Facility File and LTI databases, shows this facility was either first licensed or submitted for licensure on 2-1-1955, for 60 residents. Based on this information we are requiring the facility to meet the 1971 Minimum and Desired Standards and Regulations, Homes for the Aged and Family Care Homes, the Applicable portions of the 2005 Rules for Adult Care Homes of Seven or More Beds, and the 1987 North Carolina State Building Code Section 409.1 for Institutional Buildings.	C 000		
C 101	Existing Licensed Pac- No less than '71 Rules SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0301 APPLICATION OF PHYSICAL PLANT REQUIREMENTS The physical plant requirements for each adult care home shall be applied as follows: (2) Except where otherwise specified, existing licensed facilities or portions of existing licensed facilities shall meet licensure and code requirements in effect at the time of construction, change in service or bed count, addition, renovation, or alteration; however in no case shall the requirements for any licensed facility where no addition or renovation has been made, be less than those requirements found in the 1971 "Minimum and Desired Standards and Regulations" for "Homes for the Aged and Infirm", copies of which are available at the Division of Health Service Regulation, 701 Barbour Drive, Raleigh, North Carolina, 27603 at no cost; This Rule is not met as evidenced by: 1. Based on observation the facility did not meet	C 101		

CONSTRUCTION SECTION
APR 20 2015
RECEIVEDDivision of Health Service Regulation
LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

TITLE

(X8) DATE

STATE FORM

6000

07D21

If continuation sheet 1 of 8

PRINTED: 04/09/2015
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL085002	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____		(X3) DATE SURVEY COMPLETED 03/11/2015
NAME OF PROVIDER OR SUPPLIER MOUNTAIN CARE FACILITIES		STREET ADDRESS, CITY, STATE, ZIP CODE 183 GRAGGVILLE ROAD BOONE, NC 28607			
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE	
C 101	Continued From page 1 the NC State Building Code requirements for the fire separation of storage rooms greater than 100 square feet. Improper storage of combustibles could allow a fire to spread beyond the room of origin. Findings include: Room 31, which is larger than 100 sq. feet, was originally designed and built to be a resident bedroom and is now being used for combustible storage. There are 13 mattresses and/or box springs stored in the room. This is not in conformance with the NC State Building Code which requires storage rooms larger than 100 square feet to be separated from the remainder of the facility by a 1 hour fire resistance rated fire barrier. 2. Based on observation, the facility is not fully protected with fire alarm system detection devices in all required spaces. An incomplete fire alarm system could allow a fire to be undetected until it spreads to the corridor and the remainder of the facility. Findings include: There was no smoke or heat detector, connected to the existing fire alarm system, provided in the closet off the corridor near the dining room.	C 101	REF: C 101 (1) Room 31 has been cleared of all 13 mattresses and/or box springs. REF: C 101 (2) Creekside Electronics installed a smoke detector. The detector was connected to the existing fire alarm system.	3/27/2015 3/26/2015	
C 111	Must Have Current San. & Fire Safety Reports SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0302 DESIGN AND CONSTRUCTION 1) The facility shall have current sanitation and fire and building safety inspection reports which shall be maintained in the home and available for review.	C 111	REF: C 111 (Items 1-4) Sanitation and Fire Safety Inspections reports were emailed to Dennis Horrell, DHSR.		

PRINTED: 04/09/2015
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL095002	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/11/2015
NAME OF PROVIDER OR SUPPLIER MOUNTAIN CARE FACILITIES		STREET ADDRESS, CITY, STATE, ZIP CODE 183 GRAGGVILLE ROAD BOONE, NC 28607		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X6) COMPLETE DATE
C 111	Continued From page 2 This Rule is not met as evidenced by: Based on review of documents, many of the required inspection reports were not available in the facility. Findings include: 1. There was no Sanitation inspection report available for the kitchen. 2. There was no Sanitation inspection report available for the building. 3. There was no Fire Safety inspection report available. 4. There was no Fire Alarm System inspection report available.	C 111		
C 132	Bathrooms-Must Provide Privacy SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (e) The requirements for bathrooms and toilet rooms are: (5) The bathrooms and toilet rooms shall be designed to provide privacy. Bathrooms and toilet rooms with two or more water closets (commodes) shall have privacy partitions or curtains for each water closet. Each tub or shower shall have privacy partitions or curtains; This Rule is not met as evidenced by: Based on observation, the curtain was torn at the window in the bathroom near room 20. A torn window curtain prevents privacy in the bathroom.	C 132	REF: C132 (5) Curtain was replaced.	3/27/2015
C 166	Housekeeping-Maintained Free of Hazards SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0306 HOUSEKEEPING AND FURNISHINGS (a) Adult care homes shall:	C 166		

PRINTED: 04/09/2015
FORM APPROVED

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HAL085002	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/11/2015
NAME OF PROVIDER OR SUPPLIER MOUNTAIN CARE FACILITIES		STREET ADDRESS, CITY, STATE, ZIP CODE 183 GRAGGVILLE ROAD BOONE, NC 28607		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 166	<p>Continued From page 3</p> <p>(5) be maintained in an uncluttered, clean and orderly manner, free of all obstructions and hazards;</p> <p>(e) This Rule shall apply to new and existing facilities.</p> <p>This Rule is not met as evidenced by:</p> <p>1. Based on observation, a window was cracked beside the exit door near the kitchen. The edge of the crack was sharp to the touch. A sharp surface in the corridor could endanger the residents.</p> <p>2. Based on observation, the hose on the shower wand in the tub room across from room 33 was long enough to reach the tub basin and there was no vacuum breaker provided. Hoses on water fixtures that are long enough to reach the flood rim of the fixture present the possibility of siphoning contaminated water into the water system unless a vacuum breaker is installed.</p> <p>3. Based on observation, there was an open drain in the corridor near the dining room where a water cooler had been removed. Drains that are not properly sealed can allow noxious and combustible gases to enter the facility.</p>	C 166	<p>REF: C166(1) - Window glass was replaced.</p> <p>REF: C166(2) - Vacuum breaker was installed in shower wand.</p> <p>REF: C166(3) - Open drain was capped to seal.</p>	<p>3/30/2015</p> <p>3/12/2015</p> <p>3/10/2015</p>
C 169	<p>Building Equipment Maintained Safe, Operating</p> <p>SECTION .0300 - PHYSICAL PLANT</p> <p>10A NCAC 13F.0311 OTHER REQUIREMENTS</p> <p>(a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition.</p> <p>(k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e)</p>	C 169		

Division of Health Service Regulation STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER: HA098002	(X2) MULTIPLE CONSTRUCTION A. BUILDING: 01 B. WING: _____	(X3) DATE SURVEY COMPLETED 03/11/2015
NAME OF PROVIDER OR SUPPLIER MOUNTAIN CARE FACILITIES		STREET ADDRESS, CITY, STATE, ZIP CODE 183 GRAGGVILLE ROAD BOONE, NC 28607		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
C 189	Continued From page 4 which shall not apply to existing facilities. This Rule is not met as evidenced by: Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include: 1. Holes in the basement ceiling around water pipes. 2. Hole, approximately 12 inches by 20 inches, where a plumbing repair had been made in the ceiling of the furnace room beside the kitchen.	C 189	REF: C189 (1) - Fireproof caulking was installed around water pipes in basement. REF: C189 (2) - Fireproof sheet rock was installed to repair hole in furnace room ceiling.	3/23/2015 3/30/2015
C 195	Hot Water System SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (d) The hot water system shall be of such size to provide an adequate supply of hot water to the kitchen, bathrooms, laundry, housekeeping closets and soil utility room. The hot water temperature at all fixtures used by residents shall be maintained at a minimum of 100 degrees F (38 degrees C) and shall not exceed 116 degrees F (46.7 degrees C). (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: Based on observation there was no hot water available on the women's wing. Failure to provide	C 195		

Division of Health Service Regulation

STATEMENT OF DEFICIENCIES
AND PLAN OF CORRECTION(X1) PROVIDER/SUPPLIER/CLIA
IDENTIFICATION NUMBER:

HAL098002

(X2) MULTIPLE CONSTRUCTION

A. BUILDING: 01

B. WING: _____

(X3) DATE SURVEY
COMPLETED

03/11/2015

NAME OF PROVIDER OR SUPPLIER

MOUNTAIN CARE FACILITIES

STREET ADDRESS, CITY, STATE, ZIP CODE

183 GRAGGVILLE ROAD
BOONE, NC 28607(X4) ID
PREFIX
TAGSUMMARY STATEMENT OF DEFICIENCIES
(EACH DEFICIENCY MUST BE PRECEDED BY FULL
REGULATORY OR LSC IDENTIFYING INFORMATION)ID
PREFIX
TAGPROVIDER'S PLAN OF CORRECTION
(EACH CORRECTIVE ACTION SHOULD BE
CROSS-REFERENCED TO THE APPROPRIATE
DEFICIENCY)(X5)
COMPLETE
DATE

C 195

Continued From page 5

hot water at all required fixtures interferes with
the residents quality of life.

C 195

REF:

C 195

Brooks Plumbing & Heating
repaired hot water on
the Women's Wing.

3/11/2015